
Appendix --- Operating Process

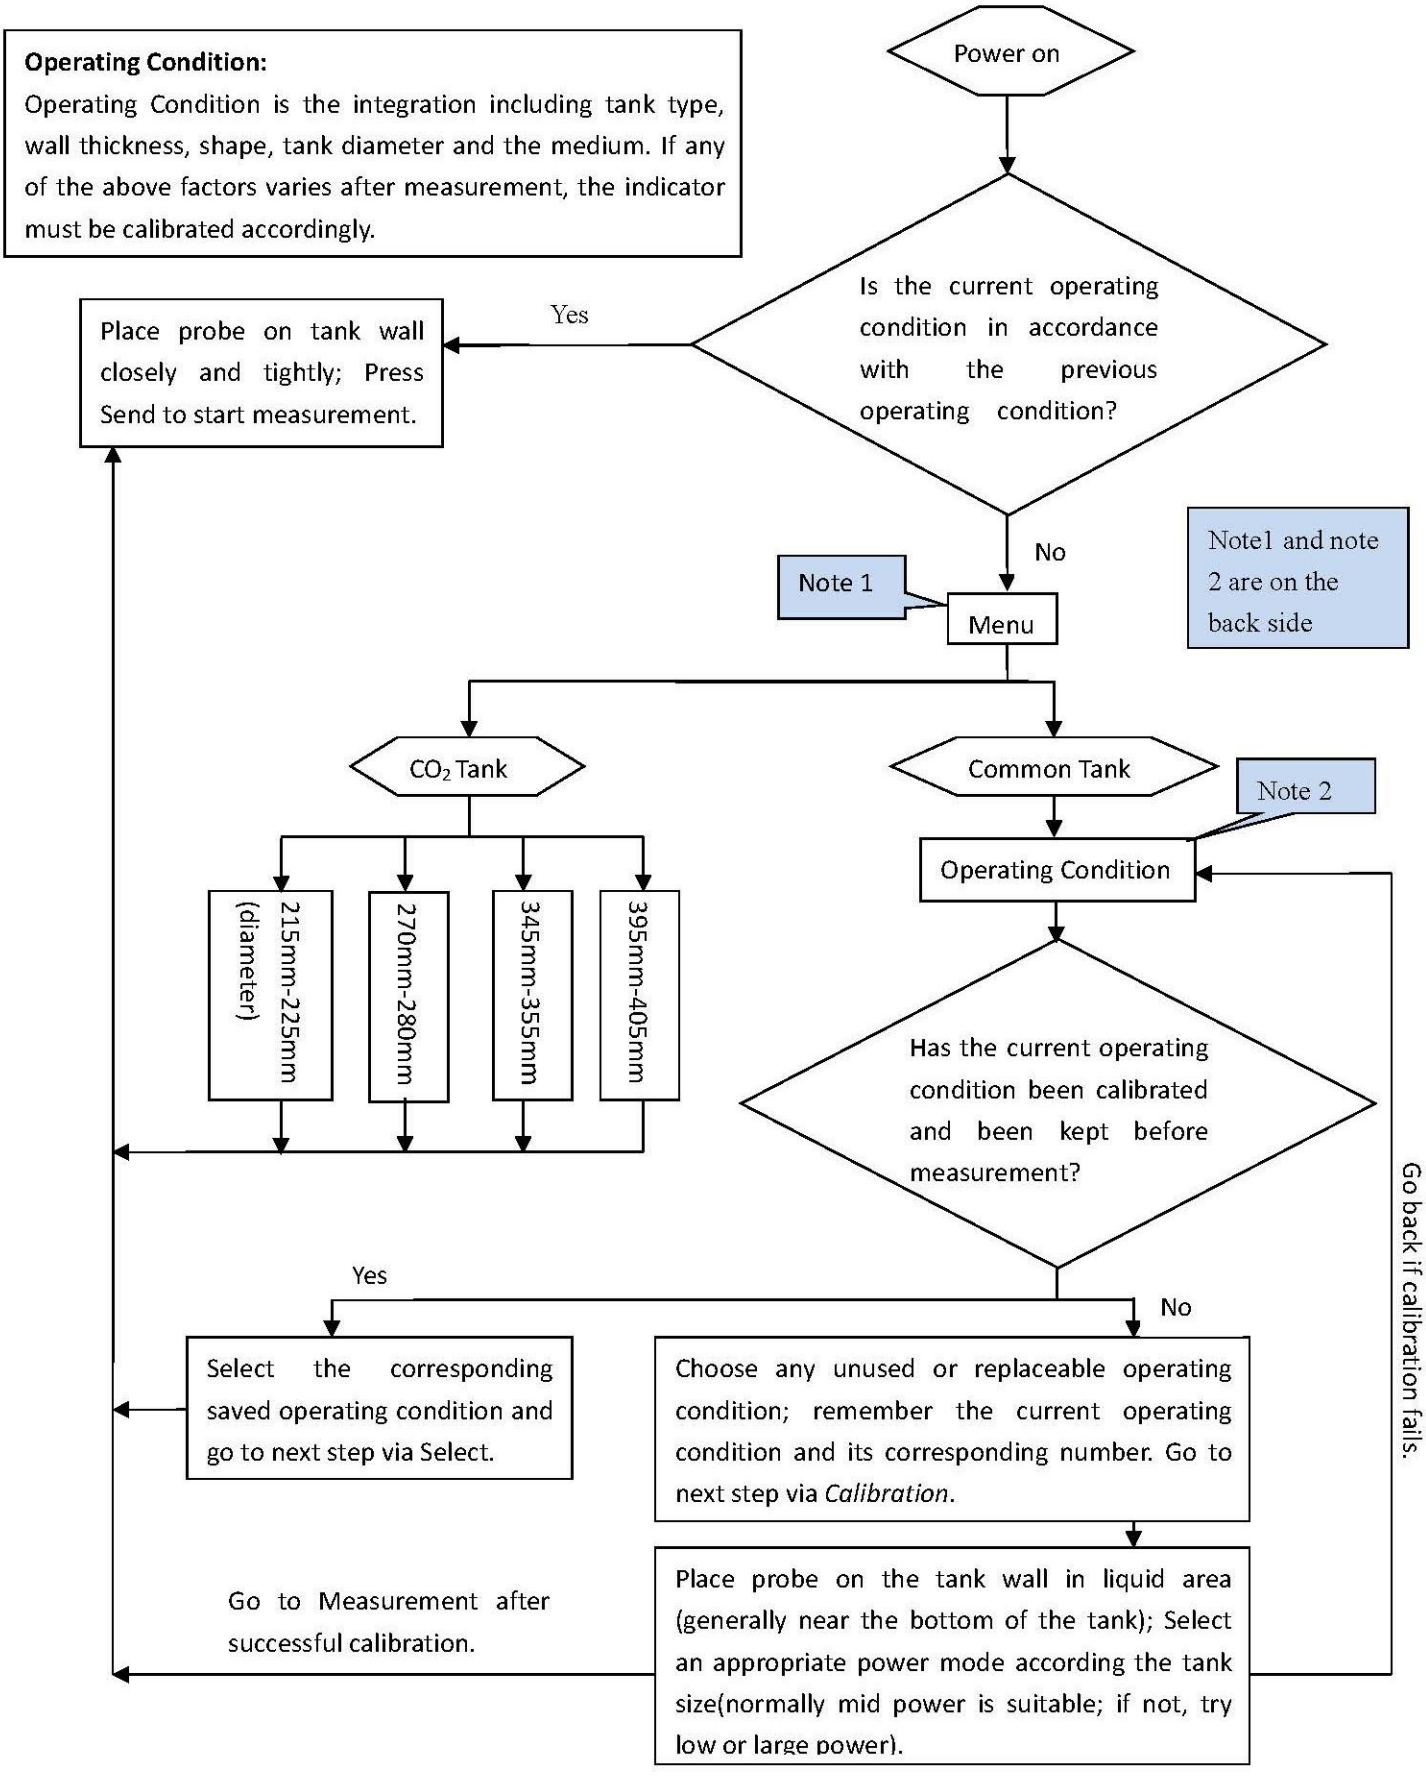

Note:

1. Enter menu by pressing Menu button in measurement interface; press Menu in menu interface again to be back to measurement interface.
2. To reduce operator's work and increase measuring efficiency, the system can save parameters of 5 types of operating condition. Any operating condition can be replaced by new operating condition. The operator should record the current operating condition number.